## GARDEN ISLAND HELIPORT

**ELEV 36**

**AVFAX CODE 6023**

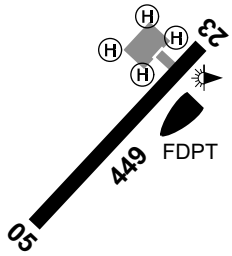


WA UTC +8 YGAD
321430S 1154102E VAR 2 DEG W MIL
AD OPR NAVY, HMAS Stirling, Rockingham, WA, 6958.
Email: stir.hsf@defence.gov.au. PH Airfield Manager: 08 9553 3921: 0448 719 837.

### REMARKS

1. ACFT OPR in vicinity of HMAS Stirling (including embarked ACFT) CTC Airfield Manager 24HR PN.
2. MIL OPS only. HLS not open for public use.
3. REQ to disembark alongside to be approved by Port Services Manager through incompatible operations signal to HMAS Stirling, ATTN PSM West.
4. Visiting ACFT to use 'HSF ACFT MAINT' 132.5 MHz to CTC maintenance staff.
5. Flight Deck Procedural Trainer (FDPT) is hazardous and not to be used without approval from AD MGR.

### HANDLING SERVICES AND FACILITIES

F44 24HR PN.

### RESCUE AND FIREFIGHTING SERVICES

1. CAT 4 AVBL MON-FRI - 2330 – 0800 UTC EXC PH. HO 24HR PN.
2. ARFFS MNT CTAF 121.0 MHz.

### AERODROME OBSTACLES

Numerous vegetation and terrain infringements of APCH, TKOF and PSA in proximity to RWY.

### METEOROLOGICAL INFORMATION PROVIDED

1. METAR/SPECI.
2. AWIS Phone 08 6216 2614 - Report faults to BoM.

### PHYSICAL CHARACTERISTICS

05/23 048 15a PCR 120/F/B/1.00 MPa/T WID 34
Slope 1.9% up to SW FM THR RWY 23 for 100M then 1.6% down to SW to THR RWY 05.

### AERODROME AND APPROACH LIGHTING

RWY 05/23 LIRL PAL 124.1
RWY edge LGT non-standard spacing: less than 55M.

### OTHER LIGHTING

1. TWY edge LGT and APN edge LGT non-standard colour: yellow.
2. APN edge LGT non-standard spacing: greater than 30M.
3. Holding point unlit.

### ATS AND AERODROME COMMUNICATION FACILITIES

FIA PERTH CENTRE 135.25 Circuit Area

### LOCAL TRAFFIC REGULATIONS

All takeoffs and landings are to be made from the RWY sealed SFC due to limited movement area.

### FLIGHT PROCEDURES

1. Circuit HGT 500FT AGL. Circuit ALT BTN 200 – 2,000FT permitted. Non-standard circuit HGT to be advised.
2. Circuit direction: RWY 05 - Right hand, RWY 23 - Left hand.

**CTAF** 121.0

Information may be continued on the next page: PTO

## NOISE ABATEMENT PROCEDURES

1. ACFT to remain 0.5NM clear of mainland when BLW 1,500FT AMSL, particularly Rockingham and Point Peron.
2. ACFT not to overfly HMAS Stirling FAC.

## ADDITIONAL INFORMATION

1. Caution: Hazardous obstacles ADJ to APN with non-compliant line markings.
2. Bird hazard exists. Species-specific NOTAM will be issued during periods of increased activity.

## CHARTS RELATED TO THE AERODROME

WAC 3462.