
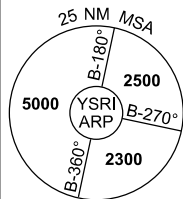


STANDARD INSTRUMENT DEPARTURES (SID)
RICHMOND FIVE DEPARTURE (RADAR)
RICHMOND, NSW (YSRI)

09 JUL 2026

ATIS/AWIS (AH) 126.3 274.55	SMC 128.25	TWR 135.5 257.3	APP 135.9 363.8	FIA (AH) SY CEN 124.55	CTAF+AFRU (AH) 135.5	AFRU+PAL 135.5	Bearings are Magnetic Elevations in FEET AMSL
--------------------------------	---------------	--------------------	--------------------	---------------------------	-------------------------	-------------------	--

NOT TO SCALE

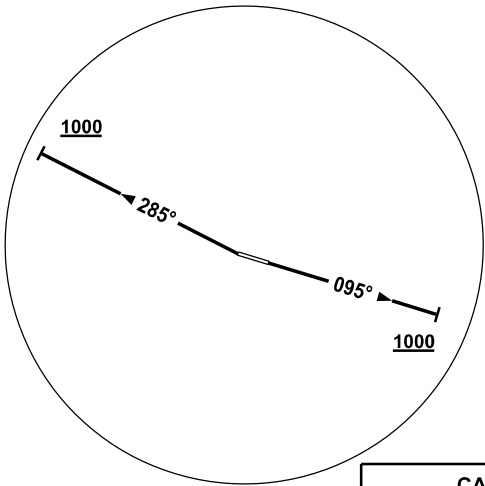

CAUTION:
TREES IN RWY 10 & RWY 28
DEP AREA

10 NM MSA 3300

RICHMOND FIVE DEPARTURE (RADAR)

RWY 28

- GRAD 4.8% to 2600ft, then 3.3%
- Track 285°
 - At 1000ft BUT NOT BEFORE DER turn to assigned heading

RWY 10

- GRAD 3.7% to 300ft, then 3.3%
- Track 095°
 - At 1000ft BUT NOT BEFORE DER turn to assigned heading or track

COMMUNICATION FAILURE PROCEDURE

- On recognition of communication failure:
- Squawk 7600
 - Maintain last assigned vector for two minutes, and
 - CLIMB IF NECESSARY TO MINIMUM SAFE ALTITUDE, to maintain terrain clearance, then
 - proceed in accordance with the latest ATC route clearance acknowledged.