
27 NOV 2025

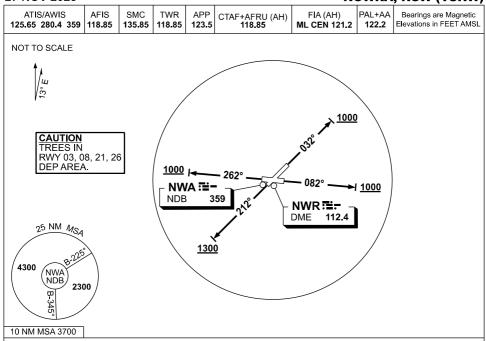

NOWRA FIVE DEPARTURE (RADAR)

RWY 03

- GRAD 4.8% to 2600ft then 3.3%
- Track 032°
- AT or ABV 1000ft but not before DER, turn to assigned heading or track

RWY 08

- GRAD 3.8% to 2600ft then 3.3%
- Track 082°
- AT or ABV 1000ft but not before DER, turn to assigned heading or track

RWY 21

- GRAD 4.3% to 1300ft then 3.3%
- Track 212°
- AT or ABV 1300ft but not before DER, turn to assigned heading or track

RWY 26

- GRAD 4.7% to 1300ft then 3.3%
- Track 262°
- AT or ABV 1000ft but not before DER, turn to assigned heading or track

COMMUNICATIONS FAILURE PROCEDURE

On recognition of communications failure

- Squawk 7600
- Maintain last assigned vector for two minutes, and
- CLIMB IF NECESSARY TO MINIMUM SAFE ALTITUDE, to maintain terrain clearance, then
- Proceed in accordance with the latest ATC route clearance acknowledged.

Changes: ADDED RWY 08 IN THE CAUTION NOTE, Editorial.



