ELEV 1346

HALLS CREEK AVEAX CODE 6908

WA 181402S

UTC +8 1274011F VAR 3 DEG E

AD OPR Aerodrome Management Services, PO Box 226, Halls Creek, WA, 6770. Email: hcairport@amsaustralia.com. PH 0437 170 368. ARO 0437 170 368.

REMARKS

- 1. AD Charges: All ACFT.
- 2. Airside gate access CTC ARO. 3.
 - Landside gate access C1234X.

AIR BP - AVGAS H24 self serve bowser (with AirBP carnet card). Aerodrome Management Services (AMS) - JET A1 H24 self serve bowser (with AMS carnet card).

Credit card accepted for both by OPR MON-FRI 2200-0800 UTC. 1HR PN required. Call out fee \$150. Phone ARO. Direct applications for AMS JET A1 carnet cards to

hcairport@amsaustralia.com.

PASSENGER FACILITIES

WC - access C2739.

METEOROLOGICAL INFORMATION PROVIDED

- TAF CAT C, METAR/SPECI. 1
- 2. AWIS Phone 08 6216 2617 - Report faults to BoM.

PHYSICAL CHARACTERISTICS

04/22	041	48a	PCN 10 /F /A /1000 (145PSI) /T Sealed.	WID 30	RWS 90
08/26	083	31c	5700/550 (80PSI) Red gravel	WID 18	RWS 60

AERODROME AND APPROACH LIGHTING

RWY 04/22 AFRU+PAL 126.7 I IRI

- RWY edge light spacing: 04/22: 60M. 1.
- 2. No standby/backup PWR AVBL.

OTHER LIGHTING

TWY LGT: Blue edge.

ATS AND AERODROME COMMUNICATION FACILITIES 118.2 On Ground

FIA BRISBANE CENTRE

RADIO NAVIGATION AND LANDING AIDS

Range 50 (HN 50) NDB HI C 245 181359.2S 1274020.8E (1)

(1)Pilot monitored.

LOCAL TRAFFIC REGULATIONS

- ACFT ABV 5,700KG MTOW must use turning nodes for 180 DEG turns RWY 04/22. 1.
- 2. ACFT BLW 5.700KG MTOW requested to use MAX radius and MNM speed turns to avoid pavement damage.
- 3. Aircraft tie down points (not rated) provided on the Main Apron and GA Parking.


FLIGHT PROCEDURES

Bungles scenic flights conform to the following Standard Operating Procedures. These procedures include adherence to the Table of Cruising Levels.

- a. From Halls Creek track to the South West Tip of the Bungles via McIntosh Hills. Returning, depart the Southern Tip of the Bungles tracking direct to Halls Creek.
- b. Operate around the Bungles in accordance with the procedures specified in ERSA GEN - Special Procedures (Not Associated with an Aerodrome).

CTAF - AFRU 126.7

8 946

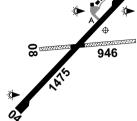

YHI C CFRT

ADDITIONAL INFORMATION

- 1. Bird hazard. Increased black kites and corellas HJ activity on and in VCY of AD. CTC 126.7 for real time information.
- 2. Wildlife hazard (wallabies) on AD. Increased ACT HN.

CHARTS RELATED TO THE AERODROME

- 1. WAC 3222.
- 2. Also refer to AIP Departure and Approach Procedures.