


**STANDARD ARRIVAL ROUTE (STAR)
BERNI FOUR VICTOR ARRIVAL (RNAV) RWY 32
GOLD COAST, QLD (YBCG)**

19 MAR 2026

ATIS 112.3 134.5 (H24) (TWR HR)	APP BN 123.5	TWR 118.7	SMC 121.8	FIA (AH) BN CEN 119.5	AWIS (AH) 134.5	CTAF+AFRU (AH) AFRU+PAL (AH) 118.7	Bearings are Magnetic Elevations in FEET AMSL
--	------------------------	---------------------	---------------------	---------------------------------	---------------------------	---	--

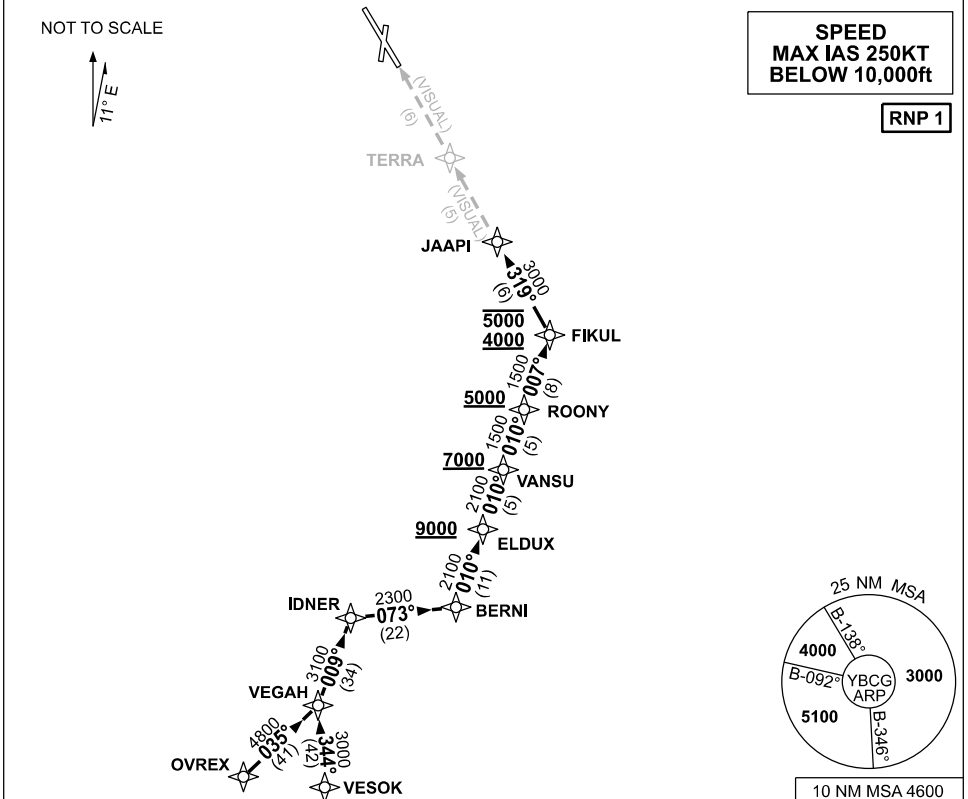

TRANSITIONS:

OVREX:

- Track 035° to VEGAH
- Turn LEFT track 009° to IDNER
- Turn RIGHT track 073° to BERNI

VESOK:

- Track 344° to VEGAH
- Turn RIGHT track 009° to IDNER
- Turn RIGHT track 073° to BERNI

THEN FOLLOW ARRIVAL INSTRUCTION

BERNI FOUR VICTOR ARRIVAL RWY 32

- From BERNI track 010° to ELDUX
Cross ELDUX AT or ABV 9000ft
- Track 010° to VANSU
Cross VANSU AT or ABV 7000ft
- Track 010° to ROONY
Cross ROONY AT or ABV 5000ft
- Turn LEFT track 007° to FIKUL
Cross FIKUL BTN 4000ft and 5000ft
- Turn LEFT, track 319° to JAAPI
- Track VISUAL to TERRA
- Report RWY in sight for approach instructions

COMMUNICATIONS FAILURE PROCEDURE

IF ABLE CTC GOLD COAST ATC ON TEL : 07 55995990

- Squawk 7600, comply with vertical navigation requirements, but not below MSA.
- Track via the latest STAR clearance to the nominated runway, then fly the most suitable approach in accordance with ERSB EMERG Section 1.5.

Changes: FROM SUP H181/25.

BCGSR10-186