
CURTIN AVFAX CODE 6901



 WA
 UTC +8
 YCIN

 173453S
 1234942E
 VAR 2 DEG E
 MIL

 AD OPR Department of Defence (13SQN), PO Box 536, Derby, WA, 6728. Mobile 0427 792 669.
 MIL

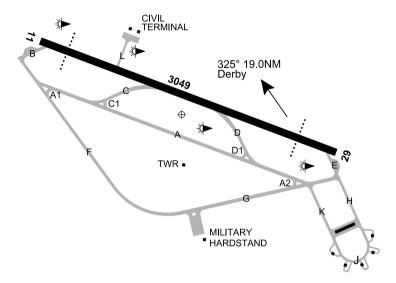

REMARKS

- 1. All ACFT require H24 PN. Support REQ are to be advised to caretaker, Phone 08 9193 9719 or MOB 0427 792 660 (AH). RAAF Darwin Air Base Command Post, MIL SIG Addressee RAYIUB/DAR ABCP, Phone 08 8923 8888.
- 2. International RAAF flights are not to plan to enter Australia through Curtin without prior approval of Department of Customs and Australian Quarantine and Inspection Service (AQIS), except in an emergency.
- 3. This AD is a Security Controlled Airport.

HANDLING SERVICES AND FACILITIES

RAAF caretakers: Phone 08 9193 9719 or AD OPR MOB. F34.

LTD fuel AVBL due Defence fuel installation there is a greater than 7 days turnaround on large fuel order RQMNTS.

APRONS AND TAXIWAYS

Civil terminal APN and TWY L PCN 21/F/B/1750(254PSI)/U. APN marked for F28 and BA46 ACFT only.

METEOROLOGICAL INFORMATION PROVIDED

- 1. TAF CAT B, METAR/SPECI.
- 2. AWIS PH 08 6216 2609 Report faults to BoM.

PHYSICAL CHARACTERISTICS

11/29 108 100a PCN 41 /F /A /1750 (254PSI) /T Central 23M WID 45 RWS 150 only. 100(328) each end concrete.

AERODROME AND APPROACH LIGHTING

RWY 11/29	MIRL	PAL 120.35		SDBY PWR AVBL
RWY 11/29	PAPI(1)	PAL 120.35	3.0 DEG48FT	SDBY PWR AVBL
(1) Limi	ted not AVRI I	hevond 2 5NM during l	I RWV 11 PAPI reduc	ad light intensity HN RWV

 Limited, not AVBL beyond 2.5NM during HJ. RWY 11 PAPI reduced light intensity HN. RWY 29 PAPI intensity fixed to RWY intensity, unable to be reduced HN. For information CTC Site Manager PH: 0427 792 669.

AD OPR to be advised with 24HR PN for all civil OPS. Civil APN floodlighting switched by Caretaker. Contact 08 9191 0999 BH, H24 Mobile 0418 922 415 or 0408 011 433.

OTHER LIGHTING

TWY LGT: Green CL.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	122.1 On ground			
APP	CURTIN APPROACH	261.4			
ATIS	CURTIN	316.3			
SMC	CURTIN GROUND	264.6			
SMCV	CURTIN GROUND	259.3			
TWR	CURTIN TOWER	118.3 257.8			
MIL ATC COMS and ATIS AVBL when CTR active.					

RADIO NAVIGATION AND LANDING AIDS

	-		-	-	
DME	CIN	114.3/ 90X	173519.5S	1235106.7E	(1)
	÷	11110/ 00/1	110010.00	1200100.12	(1)
VOR	CIN	114.3	173519.6S	1235107.2E	
VOIT		114.5	170019.00	1200107.20	
TAC	OTN		173440.7S	1234945.4E	(0)
IAC	CIN		173440.73	1234945.40	(2)

(1) Antenna ELEV 341FT AMSL.

(2) PTBL FAC ACT as RQ by MIL authorities. Channel assignment and ACT by NOTAM.

LOCAL TRAFFIC REGULATIONS

- 1. ACFT with ACN ABV 21 shall make 180 turns at RWY ends only.
- 2. TWY A, F and G are marked and can be lit as RWY. They are not to be used as RWY, except in an EMERG.
- 3. Transport and maritime ACFT to use service APN.
- 4. ACFT parking on APN between TWY H and TWY K subject to approval, restrictions apply.
- 5. Civil ACFT use TWY/APN facilities N side of RWY at W end.

FLIGHT PROCEDURES

1. REMOTELY-PILOTED AIRCRAFT SYSTEM (RPAS)

- 1.1. All RPAS requests and enquiries are to be sent to adf.airspace@defence.gov.au with at least 5 business days PN. OPS are subject to MIL OPS and may be restricted or cancelled at any time.
- 2. RPT ACFT may conduct straight-in approaches.
- 3. For special procedures which apply to the Horizontal Falls, see ERSA GEN SPECIAL PROCEDURES.

CTAF - AFRU 126.7

Outside TWR HR.

ADDITIONAL INFORMATION

Bird and kangaroo hazard exists.

CHARTS RELATED TO THE AERODROME

- 1. WAC 3223.
- 2. MIL Aerodrome Obstruction Chart Type A: AUG 2017.
- 3. Refer to AIP Departure and Approach Procedures.