

MAREEBA**ELEV 1560****AVFAX CODE 4506**

QLD

UTC +10

YMBA

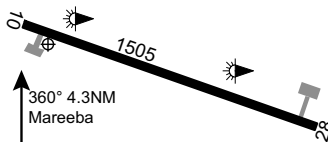
170409S

1452509E

VAR 7 DEG E

CERT

AD OPR Mareeba Shire Council, PO Box 154, Mareeba, QLD, 4880. Email:
aerodromes@msc.qld.gov.au. PH 1300 308 461. ARO AH 0407 735 835 (AH or EMERG).
Fax 07 4092 5138.

**REMARKS**

AD charges apply.

HANDLING SERVICES AND FACILITIES

IOR Aviation: AVGAS and JET A1 AVBL, self-service bowser with credit card all hours.
PH 0438 398 002.

AERODROME OBSTACLES

- Unlit power poles APRX 30FT AGL BRG 093 MAG 640M FM ARP. Infringes transitional SFC.
- Hills to the E and SE infringe the inner HZS.
- TWR (lit) 132FT AGL BRG 064 MAG 900M FM ARP.

METEOROLOGICAL INFORMATION PROVIDED

- TAF CAT D, METAR/SPECI.
- AWIS PH 07 3564 3725 - Report faults to BoM.

PHYSICAL CHARACTERISTICS

10/28 103 49 850 (123PSI) Unrated, Sealed WID 30 RWS 90

AERODROME AND APPROACH LIGHTING

RWY 10/28 LIRL PAL 120.6

RWY edge light spacing: 10/28: 60M.

OTHER LIGHTING

- TWY LGT: Blue edge.
- Manually operated standby PWR and PTBL lighting AVBL for EMERG. 30MIN PN RQ.

ATS COMMUNICATIONS FACILITIES

FIA CAIRNS APPROACH

126.1 Circuit Area

LOCAL TRAFFIC REGULATIONS

ACFT DEP Mareeba for Cairns that have obtained a Landing Slot Time FM ATC will be processed more expeditiously.

FLIGHT PROCEDURES

Right hand circuits RQ when OPR on RWY 28.

CTAF - AFRU 126.7**ADDITIONAL INFORMATION**

- Agricultural OPS take place WI 10NM up to 500FT AGL.
- Manned balloon activities may occur in 3HR following first light.
- Ultralight OPS take place at AD and WI 3NM.
- Bird hazard exists.

CHARTS RELATED TO THE AERODROME

- WAC 3219.
- Also refer to AIP Departure & Approach Procedures.