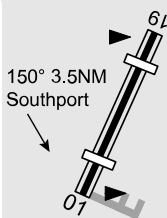


SOUTHPORT**ELEV 5****AVFAX CODE 4016****FULL NOTAM SERVICE NOT AVBL**

QLD
275518S 1532217E UTC +10 YSPT
VAR 11 DEG E UNCR
AD OPR Southport Flying Club, PO Box 184, Runaway Bay, QLD, 4216. PH 07
5594 7394. ARO 0412 412 632: 0418 722 318.

REMARKS

1. Restricted OPS: PPR FM AD OPR.
2. No public or commercial OPS permitted.
3. Multi ENG OPS not permitted.

AERODROME OBSTACLES

Transition surfaces infringed by trees.

PHYSICAL CHARACTERISTICS

01/19 26c Unrated. Natural. Central 9M sealed. RWY LEN WID 18 RWS 60
778M.

1. RWY 01 DTHR 190M.
2. RWY 19 DTHR 140M.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 119.5 On Ground

FLIGHT PROCEDURES

1. Right hand CCTS RQ when OPR on RWY 19.
2. COASTAL TRANSIT IN CLASS G AIRSPACE
Due high density TFC low level coastal ACFT should fly:
Southbound - 1,000FT AMSL
Northbound - 500FT AMSL

CAUTION: Concentrated TFC BTN Southport and Gold Coast at 500FT - see also GOLD COAST CTAF procedures.

3. No straight in approaches on either RWY.

CTAF - AFRU 119.0

NOISE ABATEMENT PROCEDURES

Noise abatement applies - contact AD OPR.

ADDITIONAL INFORMATION

Bird and animal hazard exists.

CHARTS RELATED TO THE AERODROME

WAC 3340, 3357.