
# HAMILTON ISLAND AVFAX CODE 4403

ELEV .	15
--------	----

QLDUTC +10YBHM202129S1485706EVAR 8 DEG ECERTAD OPR Great Barrier Reef Airport Pty Ltd, PO Box 201, Hamilton Island, QLD, 4803.PH 07 4946 8620. ARO 0414 594 592. Fax 07 4948 9944.CERTWebsite: www.hamiltonisland.com.au/airport.Website: www.hamiltonisland.com.au/airport.VIC +10YBHM

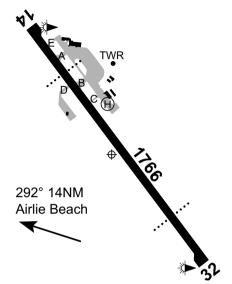

### REMARKS

#### 1. PPR.

- 2. AD charges apply. Further information AVBL on website.
- 3. This AD is a Security Controlled Airport.

#### HANDLING SERVICES AND FACILITIES

VIVA: Whitsunday Aviation Refuelling PTY LTD - 2130-0600 UTC AH call-out fee will apply. PN required. Mobile 0412 936 177, AVGAS, JET A1. VIVA Fuel2Sky Card, Viva Global Carnet Card and Credit Cards (V and MC).

### General

AD OPR does not provide marshalling services.

#### PASSENGER FACILITIES

BU/HC/AC/LG/RF/WC

# **RESCUE AND FIREFIGHTING SERVICES**

- 1. CAT 7:
  - a. TUE-SUN 2200-0545 UTC.
  - b. MON 2200-0645 UTC.
- 2. 131.0 MHz AVBL HO.
- 3. Water Rescue Service AVBL.

### **AERODROME OBSTACLES**

- 1. Transient yacht masts may infringe RWY 14/32 APCH slope clearance.
- 2. Unlit control tower 99FT AMSL BRG 348 MAG 597M FM ARP. Infringes OLS by 6FT.
- 3. Lit TWR 92FT AMSL BRG 345 MAG 592M FM ARP. Infringes TNS by 4FT.

# METEOROLOGICAL INFORMATION PROVIDED

- 1. TAF CAT B, METAR/SPECI, AD WRNG.
- 2. AWIS Phone 07 3564 3716- Report faults to BoM.
- 3. AWIS FREQ 124.75 (requires two SEC pulse to activate) Report faults to AD OPR.

### PHYSICAL CHARACTERISTICS

14/32 135 58a PCN 41 /F /A /1400 (203PSI) /T Grooved WID 45 RWS 150 RWS WID 90(295) for ACFT BLW 22,700KG MTOW by day in VMC. Marked by white cones.

# AERODROME AND APPROACH LIGHTING

RWY 14/32	MIRL(1)
RWY 14/32	PTBL(3)

RVVY 14/32	PIBL(3)	
RWY 14	PAPI(2)	3.0 DEG47FT
RWY 32	PAPI(2)	3.0 DEG48FT

(1) LGT RQ MAN switching. Prior notice RQ.

(2) LGT RQ MAN switching. Prior notice RQ. Double Sided.

(3) Fixed wing ACFT in EMERG only. 60 MIN PN. CTC ARO.

RWY edge light spacing: 14/32: 60M.

# **OTHER LIGHTING**

- 1. Secondary PWR switchover time: 60 SEC.
- 2. TWY LGT: Blue edge on A and B.
- 3. 4 MIOL associated with local topography. 3 LIOL associated with AD fixtures.

### ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE

- ATIS HAMILTON ATIS
- TWR HAMILTON TOWER
- 1. TWR HR: as per NOTAM
  - Phone 07 4946 9123^.

Note: TWR HR may change at short notice, check status of airspace with ATS or Hamilton ATIS.

128.35

118.7

- 2. Hamilton TWR provides combined TWR and APP CTL services within Class D airspace 4,500FT AMSL and BLW DRG TWR HR. CTC TWR for a clearance.
- 3. Outside TWR HR, Hamilton Class D airspace becomes Class G.
- 4. Brisbane Centre 133.2 operates Hamilton Island Class C airspace H24.

# LOCAL TRAFFIC REGULATIONS

- 1. Limited parking available Contact AD OPR for further information.
- Due pavement disturbance ACFT ABV 23,000KG must use RWY turning nodes for 180DEG turns unless directed by ATC.
- 3. Phone Hamilton TWR for training and practice instrument APCH approval DRG TWR HR.

### FLIGHT PROCEDURES

- 1. Right hand circuits when OPR on RWY 14.
- Helicopters to/from Hamilton Island Air apron must track parallel to the duty RWY on ARR or DEP unless specified by ATC.

#### CTAF - AFRU 127.85

- 1. CTAF AFRU AVBL for ACFT on ground Hamilton Island. Range 5NM.
- 2. CTAF ACT outside TWR HR.

### ADDITIONAL INFORMATION

- 1. Bird hazard exists.
- 2. ACFT carrying livestock or Dangerous Goods Class 1 explosives require prior approval from AD OPR.
- 3. Turbulence and associated windshear can be expected on APCH to RWY 14 when wind strength is 15KT or greater from the North East to East South East.

# CHARTS RELATED TO THE AERODROME

- 1. WAC 3234, 3235.
- 2. Aerodrome Obstacle Chart Type A: July 2021.
- 3. Also refer to AIP Departure and Approach Procedures.

ARRANGEMENT SDBY PWR AVBL SDBY PWR AVBL

135.5 Circuit Area (Outside TWR HR)

SDBY PWR AVBL