

PORTLAND**ELEV 266****AVFAX CODE 3013**

VIC

UTC +10

YPOD

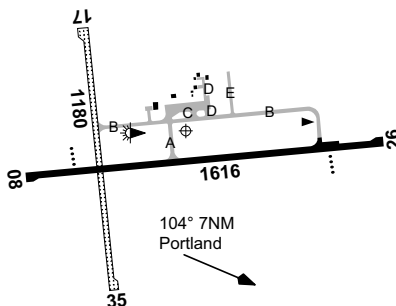
381905S

1412816E

VAR 10 DEG E

CERT

AD OPR Glenelg Shire Council, PO Box 152, Portland, VIC, 3305. PH 0427 360 578 H24. Council
PH 03 5522 2200. Fax Council 03 5522 2290.

**REMARKS**

AD Charges: All commercial ACFT.

HANDLING SERVICES AND FACILITIES

Portland Aero Club: AVGAS H24 self-service bowser. V and MC. Phone 0417 163 324.

Glenelg Shire Council: JET A1 H24 self-service bowser. V and MC. Phone 0427 360 578.

APRONS AND TAXIWAYS

1. TWY A, TWY B (FM TWY A to TWY C) and TWY C, sealed PCN 14/F/B/850 (123PSI).
2. TWY D and TWY E, sealed MAX 5,700KG.
3. TWY B west of TWY A and east of TWY E, grassed MAX 5,700KG.

METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT D, METAR/SPECI.
2. AWIS PH 03 8470 3204 - Report faults to BoM.
3. AWIS FREQ 118.75 - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

08/26	077	53a	PCN 14/F/B/0.85 MPa/T	WID 30	RWS 150
17/35	167	39c	5700 kg/0.55 MPa Natural Surface. Central	WID 30	RWS 90
			23M Gravel		

AERODROME AND APPROACH LIGHTING

RWY 08/26	LIRL	AFRU+PAL 127.95	SDBY PWR AVBL
RWY 08/26	PAPI(1)	AFRU+PAL 127.95	SDBY PWR AVBL

(1) Left side.

1. RWY edge light spacing: 08/26: 60M.
2. HJ selection of PAL will only activate PAPI. RWY lights will only OPR when poor light levels exist.

OTHER LIGHTING

1. Secondary PWR switchover time: 15 SEC.
2. TWY A, TWY B (from TWY A to TWY C) and TWY C Green CL.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	125.8 Circuit Area
-----	------------------	--------------------

CTAF - AFRU 127.95**ADDITIONAL INFORMATION**

Bird and animal hazard exists.

CHARTS RELATED TO THE AERODROME

1. WAC 3469.
 2. Also refer to AIP Departure and Approach Procedures.
-