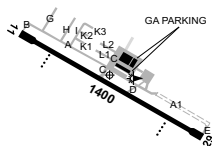


SCONE**ELEV 745****AVFAX CODE 2023**

NSW

320214S

1504956E

UTC +10

VAR 12 DEG E

YSCO

CERT

AD OPR Upper Hunter Shire Council, PO Box 208, Scone, NSW, 2337. PH 02 6540 1100: AH AD Manager 0439 428 134. Fax 02 6545 2671.

REMARKS

- AD Charges: Refer to <http://upperhunter.nsw.gov.au/> for current fees and charges. Bookings for ACFT PRKG is compulsory over 5,700KG.
- Gate access code from landside to main apron is: C then the YSCO CTAF.

HANDLING SERVICES AND FACILITIES

Aero Refuellers - AVGAS and JET A1 H24 self-service bowsters. Accept Aero Refuellers cards, V and MC. PH: 0413 003 808.

PASSENGER FACILITIES

Terminal facilities AVBL in Scone Memorial Airport BLDG. Access code is C then YSCO CTAF.

METEOROLOGICAL INFORMATION PROVIDED

- TAF CAT D, METAR/SPECI.
- AWIS PH 02 9353 6449 - Report faults to BoM.
- AWIS FREQ 134.55 (requires 1 second pulse to activate) - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

11/29 110 46 PCN 15/F/C/1.20 MPa Uneven SFC due to soil WID 30 RWS 90 movement

RWS not AVBL due soft and rough SFC.

AERODROME AND APPROACH LIGHTING

RWY 11/29	LI(L)(1)	PAL 128.0	
RWY 11	PAPI(2)	PAL 128.0	3.0 DEG45FT
RWY 29	PAPI(3)	PAL 128.0	3.0 DEG46FT

- PAL requires three one-second pulses to activate.
- Right side. PAL requires three one-second pulses to activate.
- Left side. PAL requires three one-second pulses to activate.

OTHER LIGHTING

TWY LGT: Blue edge on TWY C.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 124.8 4000FT

LOCAL TRAFFIC REGULATIONS

- Exit TWY at the RWY 11 end is 7.5M wide.
- Two gravel TWY to the fire bombing base is restricted to fire bombing ACFT only.
- Main TWY BTN 'Air Pasture' and hangars not AVBL due to uneven SFC.
- Helicopter parking AVBL on TWY A between TWY C and D.

CTAF 128.0

ADDITIONAL INFORMATION

- Animal hazard (kangaroos, foxes and birds) exists WI VCY RWY 11/29.
- Caution: The pilot in command should be aware of the terrain and obstacles in the circling area prior to conducting Night IFR OPS into Scone.
- Caution: During rain, GA APN holds excessive water at entrance and near refuelling bowser.

CHARTS RELATED TO THE AERODROME

- WAC 3456.
- Also refer to AIP Departure and Approach Procedures.