

**TEMORA****ELEV 921****AVFAX CODE 2203**

NSW

UTC +10

YTEM

342517S

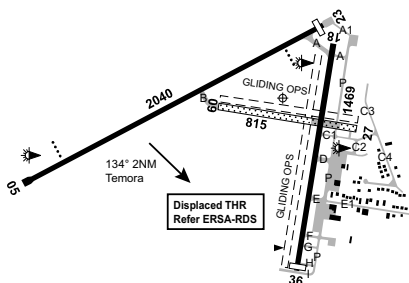
1473042E

VAR 11 DEG E

CERT

AD OPR Temora Shire Council, PO Box 262, Temora, NSW, 2666. PH 02 6980 1100 H24.

Fax 6980 1138.

**HANDLING SERVICES AND FACILITIES**

Temora Aero Club: 2200-0800 UTC MON-FRI, JF HJ, PN during BH. Phone 02 6977 2733, Fax 6978 1080. AVGAS, O117, O125.

Aero Refuellers: AVGAS bowser. Accepts Aero Refuellers card, V and MC. PH 02 6977 2733 BH. Skyfuel Australia: JET A1 + FSII and AVGAS. H24 DLY, card operated pump accepts V, MC and Skyfuel Carnet Card. PH 0418 862 100. Website: [www.skyfuel.com.au](http://www.skyfuel.com.au), for site orientation.

**AERODROME OBSTACLES**

Lit silo 1,020FT AMSL, 177DEG/2710M FM SOT RWY 18.

**METEOROLOGICAL INFORMATION PROVIDED**

1. TAF CAT D, METAR/SPECI.
2. AWIS Phone 02 9353 6453 - Report faults to BoM.
3. AWIS FREQ 134.45 (requires one-second pulse to activate) - Report faults to AD OPR.

**PHYSICAL CHARACTERISTICS**

|       |     |     |   |        |        |
|-------|-----|-----|---|--------|--------|
| 05/23 | 050 | 67a | PCN 20/F/B/1.20 MPa/T                       | WID 30 | RWS 90 |
| 09/27 | 087 | 27c | PCN 10/F/B/0.58 MPa/U Central 30(98) gravel | WID 30 | RWS 60 |
| 18/36 | 177 | 48a | PCN 10/F/B/0.58 MPa/T                       | WID 30 | RWS 90 |

**AERODROME AND APPROACH LIGHTING**

|           |            |              |               |
|-----------|------------|--------------|---------------|
| RWY 05/23 | LIRL       | PAL+AA 119.6 |               |
| RWY 05/23 | PAPI(1)    | PAL+AA 119.6 | 3.0 DEG41.3FT |
| (1)       | Left side. |              |               |

**OTHER LIGHTING**

TWY LGT: Blue edge.

**ATS AND AERODROME COMMUNICATION FACILITIES**

|        |                  |                     |
|--------|------------------|---------------------|
| FIA    | MELBOURNE CENTRE | 134.65 Circuit Area |
| UNICOM | TEMORA UNICOM    | 126.15 (1)          |

- (1) UNICOM operates during air display periods.

**FLIGHT PROCEDURES**

1. Gliding OPS HJ FM separate parallel RWS marked with orange markers immediately W of RWY 18/36 and immediately N of RWY 09/27.
2. Gliding OPS FM RWY 05/23 may be conducted from mid-field TWY B.
3. Gliders and tugs use common left CCTS.
4. Contra CCTS are not permitted under normal circumstances.
5. Independent RWY OPS are not permitted.

**CTAF 126.15**

---

**ADDITIONAL INFORMATION**

1. Bird hazard exists.
2. Aerobatics 300-5,000FT AGL immediately W of RWY 18/36, HJ.
3. Gliders and Tugs are radio equipped and will broadcast and monitor CTAF 126.15 within 10NM of the AD.
4. Gliders outside 10NM from the AD may use Glider FREQ 122.5, 122.7 or 122.9.
5. Temora Aviation Museum air displays:
  - a. D427 and R406 ACT on display weekends.
  - b. Check SUA NOTAM for activation details. Check [www.aviationmuseum.com.au](http://www.aviationmuseum.com.au) for display dates.
  - c. No flight permitted except with permission of controlling authority - Temora Historic Flight Club - UNICOM 126.15 or 0407 391 431. Non participating aircraft should plan to arrive or depart outside the display times. Priority given to display aircraft except for aircraft in emergency or Emergency Services aircraft.

**CHARTS RELATED TO THE AERODROME**

1. WAC 3456, 3457.
  2. Also refer to AIP Departure and Approach Procedures.
-