
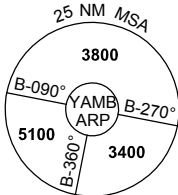


**STANDARD INSTRUMENT DEPARTURES (SID)
AMBERLEY ONE DEPARTURE (RADAR) - RWY 15/33
AMBERLEY, QLD (YAMB)**

1 MAR 2018

ATIS 359 316.2	AWIS (AH) 316.2	ACD 134.6	SMC 129.35	TWR 118.3 264.6	AMB CEN 125.25 234.55	APP 126.2 335.8	CTAF+AFRU (AH) AFRU+PAL 118.3	FIA (AH) 121.2	Bearings are Magnetic Elevations in FEET AMSL
-------------------	--------------------	--------------	---------------	--------------------	--------------------------	--------------------	-------------------------------------	-------------------	--

NOT TO SCALE

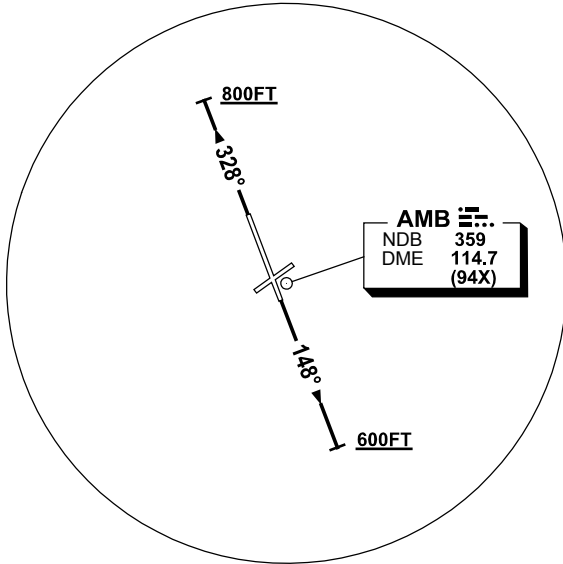

10 NM MSA 3400

AMBERLEY ONE DEPARTURE

RWY 15

- GRAD 4.3% to 2700FT, then 3.3%
- Track 148°
- At 600FT BUT NOT BEFORE DER, turn to assigned heading (NO LEFT TURN BLW 1600FT)

RWY 33

- GRAD 3.9% to 800FT, then 3.3%
- Track 328°
- At or ABV 800FT BUT NOT BEFORE 4 DME, turn to assigned heading

COMMUNICATIONS FAILURE PROCEDURE

On recognition of communication failure

- Squawk 7600
- Maintain last assigned vector for two minutes, and
- CLIMB IF NECESSARY TO MINIMUM SAFE ALTITUDE, to maintain terrain clearance, then
- proceed in accordance with the latest ATC route clearance acknowledged.

Changes: PROC NUMBER, RWY 33 DEP.

AMBDP01-154