


# STANDARD INSTRUMENT DEPARTURES (SID) PERTH SEVEN DEPARTURE (RADAR) PERTH, WA (YPPH)

7 SEP 2023

ATIS 113.7 123.8	ACD 118.55	SMC E of RWY 03/21 122.2 W of RWY 03/21 121.7	TWR 127.4	DEP 118.7	Bearings are Magnetic Elevations in FEET AMSL
---------------------	---------------	---	--------------	--------------	--

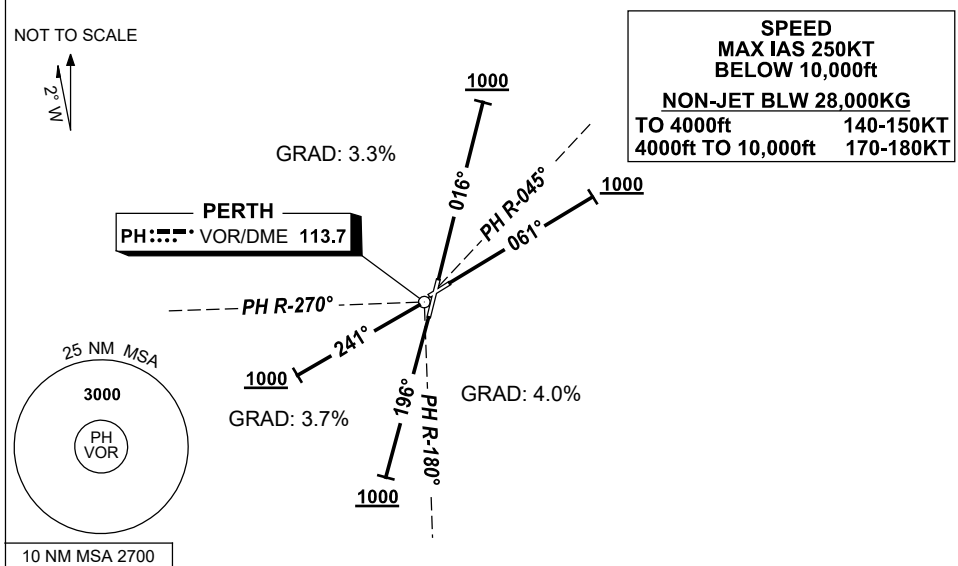

## PERTH SEVEN DEPARTURE (RADAR)

### RWY 03

- Track 016°
- AT 1000ft but not before DER turn to Assigned Heading or track
- Contact Departures for Radar Vectors

### RWY 06

- Track 061°
- AT 1000ft but not before DER turn to Assigned Heading or track
- Contact Departures for Radar Vectors

### RWY 21

- Track 196°
- AT 1000ft but not before DER turn to Assigned Heading or track
- Contact Departures for Radar Vectors

### RWY 24

- Track 241°
- AT 1000ft but not before DER turn to Assigned Heading or track
- Contact Departures for Radar Vectors

## COMMUNICATIONS FAILURE : PROCEDURE IN IMC

On recognition of communication failure.

- Squawk 7600.
- Maintain last assigned vector for 2 minutes, and
- CLIMB IF NECESSARY TO MINIMUM SAFE ALTITUDE, to maintain terrain clearance, then
- Proceed in accordance with the latest ATC route clearance acknowledged.

Changes: RWY 06/24 INITIAL TRACKS.

PPHPD01-176